



Technical Bulletin

Date: January 26, 2017

Product Line: Bambi


Models: Bambi Bucket 6072-1821

Subject: Small Tripline Design Change

Background

Triplines failing immediately below the bullet assembly has been a recurring issue on small Bambi Buckets. Several design changes have reduced the number of occurrences, but the issue has persisted on small buckets. The root cause on small buckets is believed to be the cable flexing as the bullet hits the pulley. A new design allows the cable to pivot freely immediately after the bullet to eliminate this issue.

The new designs 013055 and 013056 will replace 005335 and 005332 respectively. The new design is a direct replacement, and does not require any additional modification.

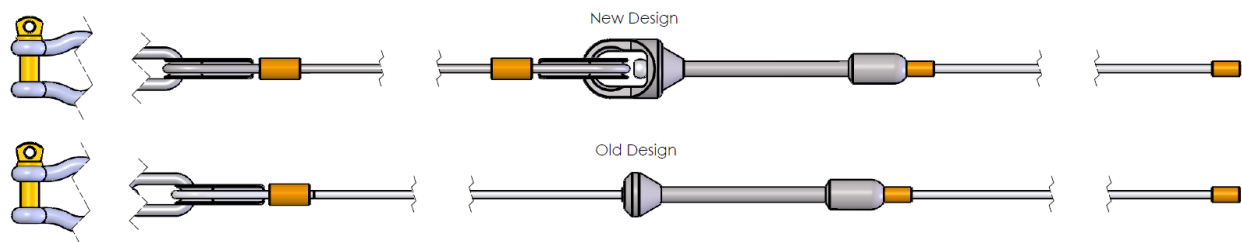

Recommendations

New triplines made by SEI will use the new design. Customers with the old design should continue to use those triplines if they have not encountered problems with them.



This Technical Bulletin is available on the SEI website. <http://www.sei-ind.com/resources/manuals>

For further details, please contact the following SEI representatives.

Contact

Shawn Bethel
Division Manager, Firefighting Division
604-946-3131 ext. 119
shawn@sei-ind.com

Robert Button, EIT
Product Engineer, Firefighting Division
604-946-3131 ext. 423
robert@sei-ind.com